


Tracy Technical Bulletin 2015-2

Evaluation of Fish Behavior Upstream and Downstream of the Mitten Crab Traveling Screen at the Tracy Fish Collection Facility



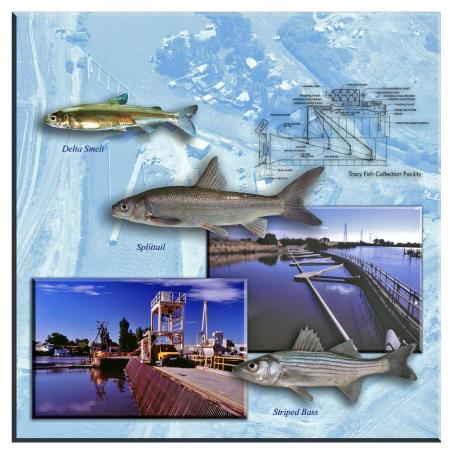

U.S. Department of the Interior Bureau of Reclamation Mid-Pacific Region and Denver Technical Service Center

maintaining the data suggestions for redu 1204, Arlington, VA 2 it does not display a	needed, and completing a cing the burden, to Depart 22202-4302. Respondents currently valid OMB contro	and reviewing the collectio ment of Defense, Washing should be aware that not	n of information. Send comn gton Headquarters Services, withstanding any other provi	nents regarding this bure Directorate for Informat	den estimate or a tion Operations a	ructions, searching existing data sources, gathering and any other aspect of this collection of information, including and Reports (0704-0188), 1215 Jefferson Davis Highway, Suite any penalty for failing to comply with a collection of information if			
1. REPORT DA May 2015	TE (DD-MM-YYYY) 2. REPOF Final	RT TYPE		3.	DATES COVERED (From - To)			
4. TITLE AND			ownstream of the N	Aitten Crab	5a. CONTR	ACT NUMBER			
		y Fish Collection			5b. GRANT	FNUMBER			
					5c. PROGR	RAM ELEMENT NUMBER			
6. AUTHOR(S) Cathy Karp	and Judy Lyons				5d. PROJE	CT NUMBER			
cumj mup					5e. TASK NUMBER				
					5f. WORK	UNIT NUMBER			
Bureau of I	Reclamation, Tec	N NAME(S) AND A hnical Service Ce arces Group, 86-6	nter		I	8. PERFORMING ORGANIZATION REPORT NUMBER			
	007, Denver, CO	. .	0270		Technical Bulletin 2015-2				
		GENCY NAME(S)	AND ADDRESS(ES)	1		10. SPONSOR/MONITOR'S ACRONYM(S)			
Tracy Fish	Reclamation, Collection Facili o Road, Byron, C	•			11. SPONSOR/MONITOR'S REPORT NUMBER(S)				
Available		l Technical Inform	nation Service (NT Springfield, VA 2						
13. SUPPLEME	ENTARY NOTE								
and return sal channel in 19 release compo secondary cha screen was in reduce second number of exp (42.5 percent) crowding syst	f Reclamation Tr vaged fish to the 99 to remove the onents. Studies a unnel. Using con operation. These lary channel louv perimental fish th b, even in best con em may help to r	Sacramento-San invasive Chinese t that time found trolled experiments e experiments sug er efficiencies. In at were released inditions of higher nove fish through	Joaquin River Delt mitten crab (<i>Erioc</i> that the screen effici ts, fish passage in gested that using ti n fact, louver effici but not recovered (velocity and scree the primary chann	a. A vertical tra <i>cheir sinensis</i>) be ciently removed the secondary cl he screen to rem ency was high (and therefore no n raised out of t hel bypasses and	veling scre efore they v crabs whil hannel was nove entrair >75 percen bt participat he flow (39 l secondary	in the mid-1950s to divert, collect, hold, een was installed in the secondary louver were concentrated into the fish holding and e allowing some fish passage through the further evaluated while the traveling hed aquatic debris did not significantly at) in all experiments. However, the ting in the experiment) was generally high 0.4 percent). This suggests that a fish channel. No recovered experimental fish f high debris while allowing for safe fish			
15. SUBJECT		uver efficiency, 7	Fracy Fish Collection	on Facility					
	CLASSIFICATION	-	17. LIMITATION OF ABSTRACT	STRACT OF PAGES		19a. NAME OF RESPONSIBLE PERSON Donald E. Portz, Ph.D.			
a. REPORT	b. ABSTRACT	a. THIS PAGE	25			PHONE NUMBER (Include area code) 445-2220			

Standard Form 298 (Rev. 8/98) Prescribed by ANSI Std. Z39.18

Tracy Fish Facility Studies California

Evaluation of Fish Behavior Upstream and Downstream of the Mitten Crab Traveling Screen at the Tracy Fish Collection Facility

Tracy Technical Bulletin 2015-2

by

Cathy Karp¹ and Judy Lyons²

¹ Bureau of Reclamation Denver Technical Service Center Fisheries and Wildlife Resources Group PO Box 25007 Denver, CO 80225-0007

²466 S. Oak Ct. Littleton, CO 80127



U.S. Department of the Interior Bureau of Reclamation Mid-Pacific Region and Denver Technical Service Center

MISSION STATEMENTS

The U.S. Department of the Interior protects America's natural resources and heritage, honors our cultures and tribal communities, and supplies the energy to power our future.

The mission of the Bureau of Reclamation is to manage, develop, and protect water and related resources in an environmentally and economically sound manner in the interest of the American public.

TRACY FISH FACILITY IMPROVEMENT PROGRAM

J. Carl Dealy, Manager

TRACY SERIES EDITOR

Donald E. Portz, Ph.D. U.S. Department of the Interior – Bureau of Reclamation Technical Service Center Fisheries and Wildlife Resources Group, 86-68290 PO Box 25007 Denver, CO 80225-0007

COVER

Fish photography by René Reyes, Tracy Fish Collection Facility, Tracy, California. Design by Doug Craft.

DISCLAIMER

Mention of commercial products does not constitute endorsement.

TABLE OF CONTENTS

Executive Summary	ES-1
Introduction	
Methodology	
Data Analysis	
Results and Discussion	
Conclusions	6
Acknowledgments	
References	

Tables

Table

Figures

Figure

0		Ŭ
1	Schematic of the vertical traveling screen, Tracy Fish Collection	
	Facility, Byron, California.	2
2a	Vertical traveling screen out of the water (control condition)	2
2b	Vertical traveling screen all the way down, steel plate flat (plant condition).	3
2c	Vertical traveling screen 30.5 cm off the secondary channel, floor-steel plate inclined 33.0 cm (crab condition). Note 7.6 cm	
	gap between 2 sets of brushes	3
3	External injuries observed in traveling screen experiments.	7

Appendices

Appendix

1 Data Summary

Page

Page

Page

EXECUTIVE SUMMARY

The U.S. Department of the Interior, Bureau of Reclamation Tracy Fish Collection Facility (TFCF) in central California was designed in the mid-1950s to divert, collect, hold, and return salvaged fish to the Sacramento-San Joaquin River Delta. One problem faced by the facility is increasing and changing aquatic debris loads which foul the louvers, holding tanks, and fish transport trucks. A vertical traveling screen was installed in the secondary channel in 1999 to remove the invasive Chinese mitten crab (*Eriocheir sinensis*) before they were concentrated into the fish holding and release components. Studies at that time found that the screen efficiently removed crabs while allowing some fish passage through the secondary channel. Using controlled experiments, fish passage in the secondary channel was further evaluated while the traveling screen was in operation. These experiments found that using the screen to remove entrained aquatic debris did not significantly reduce secondary channel louver efficiencies. In fact, louver efficiency was high (>75 percent) in all experiments. However, the number of experimental fish that were released but not recovered (and therefore not participating in the experiment) was generally high (42.5 percent), even in best conditions of higher velocity and screen raised out of the flow (39.4 percent). This suggests that a fish crowding system may help to move fish through the primary channel bypass pipes and secondary channel. No recovered experimental fish were injured. The collection of three injured wild fish may have been related to screen operation or placement of a steel plate on the channel floor used to improve debris removal. These data suggest that a vertical traveling screen can be used to remove debris during periods of high debris entrainment while allowing for safe fish passage.

INTRODUCTION

The Bureau of Reclamation has an active fish salvage improvement research program at the Tracy Fish Collection Facility (TFCF) in Byron, California. One aspect under study is the use of a vertical traveling screen in the secondary channel to remove debris. This screen was installed in 1999 to assist in removal of the Chinese mitten crab (Eriocheir sinensis) from the secondary channel. Mitten crabs invaded in the Sacramento-San Joaquin delta in 1996, and were inundating the TFCF by fall 1998. As the mitten crab invasion declined, the traveling screen and associated debris removal components were modified to remove all types of aquatic debris (Boutwell and Sisneros 2006, L. Hanna, personal communication). Aquatic weed tests in 2004/2005 found up to 56 percent of the incoming debris was removed when the screen was operating (Boutwell and Sisneros 2006; TFCF unpublished data). Salvage evaluation studies found that entrained fish were generally not impacted by the screen on their way into the holding tanks (White et al. 2000, White et al. 2005). Using controlled experiments, our objectives were to determine if the vertical traveling screen reduced louver efficiency or injured fish in the secondary channel when used to remove aquatic debris.

METHODOLOGY

The vertical traveling screen was located in the upper end of the secondary channel and when lowered, spanned the 2.4m (8 ft) width of the channel. The screen was angled 15° off vertical, rotated counterclockwise, and was run at 0.04 m/s (8 ft/minute) for all experiments (as recommended by TFCF staff; Figure 1). The screen mesh was plastic coated cabling with rectangular shaped openings $(3.8 \text{ cm} \times 14.0 \text{ cm} [1.5 \text{ in wide} \times 5.5 \text{ in high}])$. Rows of horizontal brushes (5.1 cm (2.0 in) long) on the screen face redirected debris and other entrained material to a conveyor belt. A perforated steel plate (38.1mm [1.5 in] holes), placed on the floor of the secondary channel just upstream of the lower edge of the screen (when in the water), was used to create two test conditions: crab removal (crab) = traveling screen 30.5 cm (12.0 in) off the channel floor and downstream edge of plate inclined 33.0 cm (13.0 in), producing a 76.2 mm (3 in) gap between the 2 sets of rollers and a 19.1 cm (7.5 in) gap between the edge of the plate and the lower edge of the screen, and aquatic debris removal (plant) = traveling screen down (10.2 cm off the channel bottom to allow space for the brushes) and steel plate flat (no gap between the brushes on the screen and steel plate; Figures 1, 2b, and 2c). We also tested secondary channel louver efficiency with the steel plate flat and the traveling screen out of the water (= control, Figure 2a). The two test conditions were selected because each was previously found to be effective for their target (*i.e.*, crab or aquatic plant removal). Aquatic debris/mitten crabs/fish removed by the brushes on the traveling screen were lifted away from the secondary channel

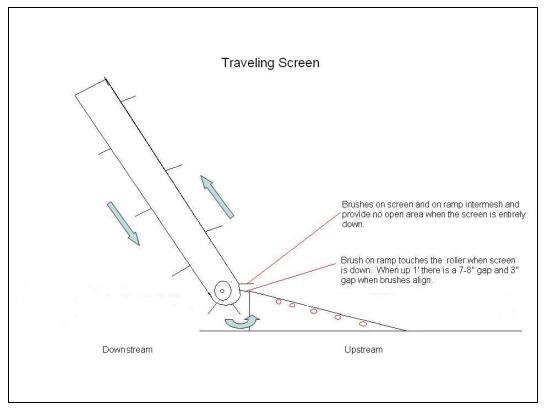


Figure 1.—Schematic of the vertical traveling screen, Tracy Fish Collection Facility, Byron, California.



Figure 2a.—Vertical traveling screen out of the water (control condition).

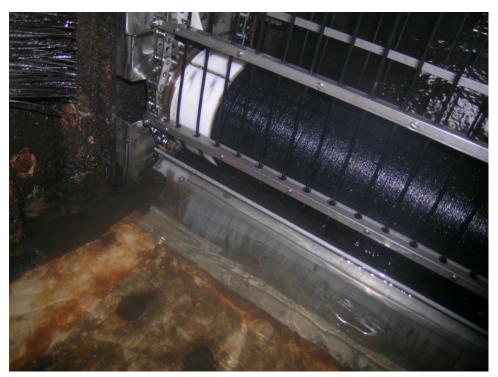


Figure 2b.—Vertical traveling screen all the way down, steel plate flat (plant condition).



Figure 2c.—Vertical traveling screen 30.5 cm off the secondary channel, floorsteel plate inclined 33.0 cm (crab condition). Note 7.6 cm gap between 2 sets of brushes.

by a conveyor belt and collected in a swimming pool for the duration of the experiment. A sieve net (2.7 m [8.8 ft] high, 2.5 m [8.1 ft] wide and 7.6 m [25 ft] long) located behind the secondary channel louvers was used to collect fish passing through the louvers. Experimental design included releasing uniquely marked groups of fish into each of the 4 primary bypass tubes (10 fish each for 40 fish per release, one species at a time) using a 10.2 cm (4.0 in) pipe inserted 1 m into the upper part of the bypass transition box, and running the secondary channel for 30 min under one of the 3 conditions (control, crab, plant). In addition, uniquely marked groups of fish were released in front of the sieve net (10 fish per release) and into the holding tank (10 fish) prior to each replicate. The latter two groups were used as a control for the fish recovery process because fish may be missed during the holding tank drain and sieve net fish recovery. At the end of the 30 min recovery period, the holding tank and sieve net were switched to a different setup to prepare for a new release. These were then drained and experimental fish recovered. A recovery period of 90 min was allowed for determination of louver efficiency for each release.

Experimental fish included a range of species and sizes to cover a range of behaviors: juvenile Chinook salmon (*Oncorhynchus tshawytscha*; n = 1,322, 60–215 mm Fork Length [FL]); splittail (*Pogonichthys macrolepidotus*; n = 1,360, 67–182 mm FL), striped bass (*Morone saxatilis*; n = 696, 130–270 mm FL), and white sturgeon (*Acipenser transmontanus*; n = 357, 115–240 mm FL). These species were selected as they may occur in the wild entrainment and were easily obtainable. Only experimental fish < 3.8cm [1.5 in] wide were used to potentially fit through the traveling screen mesh openings. Juvenile Chinook salmon were obtained from the Mokelumne River Fish Hatchery (California Department of Fish and Wildlife), white sturgeon from the Stolt Sea Farm in Elverta, California, and striped bass and splittail were collected on-site at the TFCF. All experimental fish were held in flow-through 750-L (198-gallon) tanks in a mix of ozone purified well (18–19°C) and Delta water and fed Silver Cup salmon feed.

One week prior to experiments, fish were anaesthetized using 50-ppm tricaine methanesulfonate (MS-222) and marked with fluorescent microbeads (New West Technology, Santa Rosa, California) on anal, dorsal, or caudal fins. Prior to each set of releases, the secondary channel was drained and flushed and the louvers cleaned. Secondary channel velocity was determined using TFCF meters.

Data Analysis

For each release, louver efficiency was calculated from the following formula:

```
Secondary channel louver efficiency =
```

(# fish collected in the holding tank /holding tank efficiency)/([# fish collected in the holding tank/holding tank efficiency] + [# fish collected in the sieve net/sieve net efficiency])

The number of nonparticipants, or experimental fish that were not recovered (i.e., fish that may have remained in the facility plumbing for the experimental period, moved upstream and out of the facility, moved through the louvers into the intake canal, or been predated [and remained in the channel]) was determined by subtracting those that were recovered in the holding tank and sieve net from the number released for the experimental period. These fish were not included in the above calculation. Louver efficiency and nonparticipant data were not normally distributed and Wilcoxon Signed Rank Test and Kruskal-Wallis One-Way Analysis of Variance (Statistix 8, Analytical Software) were used for analyses.

RESULTS AND DISCUSSION

A total of 97 tests were conducted at the three conditions (34 control, 31 plant, and 32 crab screen; Table 1). All four species were used to test each screen condition. Secondary channel velocities were maintained at 0.8 m/s (2.5 ft/s) for the striped bass experiments (as required by regulatory agencies [California State Water Resources Control Board 1978, NMFS 2004, USFWS 2004]) but ranged from 0.7 to 0.9 m/s (2.3 to 3.1 ft/s) for the other species. Secondary channel louver efficiencies were high (>75 percent) for all experiments. Louver efficiency among the three test conditions was similar (Kruskal-Wallis, P = 0.052), but slightly higher when the screen was not in use (98.4 percent vs 95.2 and 95.3 percent, Table 1). This suggests that operation of a vertical traveling screen for aquatic debris removal would not significantly inhibit entrained fish from moving through the secondary channel.

Up to 95.8 percent of the experimental fish were not recovered in the experiments (about 43 percent per release; Table 1). The high proportion of nonparticipation was not statistically different among screen conditions (Kruskal-Wallis, P = 0.285), nor when channel velocity was relatively higher (> 0.7 m/s, 2.3 ft/s; Wilcoxon Rank Sum Test, P = 0.053). The high proportion of missing experimental fish, even during tests when the traveling screen was out of the water and channel velocity was high (0.9 m/s, [3.0 ft/s]), suggests that some form of fish crowding may be beneficial in the primary bypass pipes and secondary channel. For example, flushing of the primary bypasses and netting in the secondary channel following one set of releases yielded 93.5 percent of the missing fish for those experiments. No experimental fish were removed by the screen. No mitten crabs were observed during the experiments. Three wild fish were noted to have injuries, possibly caused by the screen rotation or placement of the steel plate (Figure 3).

Table 1.—Summary of secondary channel velocities, louver efficiencies, and percent unaccounted for the traveling screen tests, Tracy Fish Collection Facility, Byron, California

Treatment	Number of Experimental Releases	Secondary Channel Velocity (Mean, Range, [m/s])	Secondary Channel Louver Efficiency (Mean, SD, Range [Percent]) ¹	Unrecovered fish ² (Mean, SD, Range [Percent])
Control (Traveling screen out of the water/steel plate flat)	34	0.8, 0.7–0.9 (2.7 ft/s, 2.3–3.1 ft/s)	98.4, 2.7 91.3–100	39.4 25.3 0–87.5
Plant (Traveling screen all the way down/steel plate flat)	31	0.8, 0.7–0.9 (2.7 ft/s, 2.3–3.1 ft/s)	95.2, 6.3 80.8–100	49.4 29.0 0–95.8
Crab (Traveling screen 30.5cm [12 in] off the secondary channel floor/steel plate inclined 33.0 mm [13 in])	32	0.8, 0.7–0.9 (2.7 ft/s, 2.3–3.1 ft/s)	95.3, 6.4 77.3–100	39.2 23.9 0–87.5

¹ Efficiencies calculated after 1.5 h. SD = standard deviation

² Unrecovered fish include all experimental fish that were not recovered.

CONCLUSIONS

The vertical traveling screen was tested to determine if secondary channel louver efficiency was reduced when the screen was in operation. These experiments found that screen operation did not significantly reduce louver efficiency. In fact, louver efficiency was high (>75 percent) in all experiments. However, the number of experimental fish that were released but not recovered (and therefore not participating in the experiment) was generally high (42.5 percent), even in best conditions of higher velocity and screen raised out of the flow. This suggests that a fish crowding system such as higher velocities in the secondary channel may help to move fish through the primary channel bypasses and secondary channel. No recovered experimental fish were visibly injured. The collection of three injured wild fish may have been related to screen operation or placement of the steel plate. These data suggest that the secondary channel traveling screen can be used (screen lowered all the way down) during periods of high debris while allowing for safe fish passage.



Figure 3.—External injuries observed in traveling screen experiments.

ACKNOWLEDGMENTS

We appreciate the help of Brent Bridges, Brandon Wu, and Rene Reyes (Bureau of Reclamation, Tracy Office) for assistance with the experiments. We thank Brent Bridges and Brandon Wu (Bureau of Reclamation, Tracy Office), and Don Portz (Bureau of Reclamation, Denver Technical Service Center) for reviewing the technical bulletin. We thank Ronald G. Silva, Joel Imai, and the staff at the TFCF for assistance with the experiments. This project was funded by the Bureau of Reclamation Mid-Pacific Region (Sacramento, California) under the Central Valley Project Improvement Act of 1992.

REFERENCES

- Boutwell, J.E. and D. Sisneros. 2006. Water born debris removal evaluations using a traveling screen at the Tracy Fish Collection Facility, Tracy, California, Tracy Fish Facility Studies, California, Volume 33, U.S. Department of the Interior, Bureau of Reclamation, Mid-Pacific Region and Denver Technical Service Center.
- California State Water Resources Control Board. 1978. Water Right Decision 1485 – Sacramento-San Joaquin Delta and Suisun Marsh. Sacramento, California.
- Hanna, L. 1999. Bureau of Reclamation, Hydraulic Investigations and Laboratory Services Group, Denver, Colorado, personal communication.
- National Marine Fisheries Service (NMFS). 2004. *Biological Opinion on the Longterm Central Valley Project and State Water Project Operations Criteria and Plan.* NMFS Southwest Regional Office, Long Beach, CA.
- U.S. Fish and Wildlife Service (USFWS). 2004. *Biological Opinion on the Longterm Central Valley Project and State Water Project Operations Criteria and Plan.* Sacramento, CA.
- White, R., B. Mefford, and C. Liston. 2000. Evaluation of mitten crab exclusion technology during 1999 at the Tracy Fish Collection Facility, Tracy, California. Tracy Fish Facility Studies, California, Volume 14, U.S. Department of the Interior, Bureau of Reclamation, Mid-Pacific Region and Denver Technical Service Center.

White, R., R. Tullis, L. Hess, B. Mefford, and C. Liston. 2005. Evaluation of mitten crab exclusion technology during 2000 at the Tracy Fish Collection Facility, Tracy, California. Tracy Fish Facility Studies, Tracy, California, Volume 23, U.S. Department of the Interior, Bureau of Reclamation, Mid-Pacific Region and Denver Technical Service Center.

APPENDIX 1

Data Summary

Date	Treatment	Velocity (ft/s)	Velocity condition	Number Released	Holding Tank Recovery	Sieve Net Recovery	Total Recovered	Total Missing	Holding Tank Recovery (percent)	Total Missing (percent)
5/2005	3	3.05	2	40	37	3	40	0	92.5	0
5/2005	3	3.05	2	40	37	2	39	1	94.9	2.5
5/2005	3	3.05	2	40	31	7	38	2	81.6	5
5/2005	2	3.05	2	40	30	6	36	4	83.3	10
5/2005	2	3.05	2	41	34	7	41	0	82.9	0
5/2005	2	3.05	2	40	32	5	37	3	86.4	7.5
5/2005	1	3.05	2	40	37	2	39	1	94.9	2.5
5/2005	1	3.05	2	41	39	2	41	0	95.1	0
5/2005	1	3.05	2	40	35	3	38	2	92.1	5
10/2005	1	2.3	1	24	16	0	16	8	100	33.3
10/2005	1	2.3	1	24	20	0	20	4	100	16.7
10/2005	1	2.3	1	24	7	0	7	17	100	70.8
10/2005	2	2.3	1	24	3	0	3	21	100	87.5
10/2005	2	2.3	1	24	1	0	1	23	100	95.8
10/2005	2	2.3	1	24	2	0	2	22	100	91.7
10/2005	3	2.3	1	24	9	0	9	12	100	50
10/2005	3	2.3	1	24	12	0	12	12	100	50
10/2005	3	2.3	1	24	7	0	7	17	100	70.8
11/2005	1	2.3	1	40	36	0	36	4	100	10
11/2005	1	2.3	1	40	21	0	21	19	100	47.5
11/2005	1	2.3	1	40	8	0	8	32	100	80

Date	Treatment	Velocity (ft/s)	Velocity condition	Number Released	Holding Tank Recovery	Sieve Net Recovery	Total Recovered	Total Missing	Holding Tank Recovery (percent)	Total Missing (percent)
11/2005	1	2.3	1	40	25	0	25	15	100	37.5
11/2005	1	2.3	1	40	13	0	13	27	100	67.5
11/2005	1	2.3	1	40	12	0	12	28	100	70
11/2005	3	2.3	1	40	34	0	34	5	100	12.5
11/2005	3	2.3	1	40	39	0	39	1	100	2.5
11/2005	3	2.3	1	40	32	0	32	8	100	20
11/2005	2	2.3	1	40	25	0	25	15	100	37.5
11/2005	2	2.3	1	40	11	0	11	29	100	72.5
11/2005	2	2.3	1	40	6	0	6	34	100	85
10/2007	1	2.51	2	40	29	1	30	10	96.7	25
10/2007	1	2.51	2	40	28	0	28	12	100	30
10/2007	1	2.51	2	40	15	1	16	24	93.8	60
10/2007	1	2.51	2	40	14	0	14	26	100	65
10/2007	1	2.51	2	40	8	0	8	32	100	80
10/2007	1	2.51	2	40	5	0	5	35	100	87.5
10/2007	1	2.51	2	40	18	0	18	22	100	55
10/2007	1	2.51	2	40	15	0	15	25	100	62.5
10/2007	1	2.51	2	40	21	2	23	17	91.3	42.5
10/2007	1	2.51	2	40	14	1	15	25	93.3	62.5
10/2007	1	2.51	2	40	18	1	19	21	94.7	52.5
12/2007	1	3	2	40	26	0	26	14	100	35
12/2007	1	3	2	40	29	1	30	10	96.7	25
12/2007	1	3	2	40	25	0	25	15	100	37.5

Date	Treatment	Velocity (ft/s)	Velocity condition	Number Released	Holding Tank Recovery	Sieve Net Recovery	Total Recovered	Total Missing	Holding Tank Recovery (percent)	Total Missing (percent)
12/2007	1	3	2	40	29	0	29	11	100	27.5
12/2007	1	3	2	40	21	0	21	19	100	47.5
12/2007	1	3	2	40	22	0	22	18	100	45
1/2006	1	3.1	2	40	38	0	38	2	100	5
1/2006	1	3.1	2	40	32	0	32	8	100	20
10/2007	2	2.51	2	40	23	4	27	13	85.2	32.5
10/2007	2	2.51	2	40	26	0	26	14	100	35
10/2007	2	2.51	2	40	10	1	11	29	90.9	72.5
10/2007	2	2.51	2	40	12	1	13	27	92.3	67.5
10/2007	2	2.51	2	40	4	0	4	36	100	90
10/2007	2	2.51	2	40	6	1	7	33	85.7	82.5
10/2007	2	2.51	2	40	10	0	10	30	100	75
10/2007	2	2.51	2	40	9	0	9	31	100	77.5
10/2007	2	2.51	2	40	19	1	20	20	95	50
10/2007	2	2.51	2	40	21	5	26	14	80.8	35
10/2007	2	2.51	2	40	20	2	22	18	90.9	45
12/2007	2	3	2	40	27	1	28	12	96.4	30
12/2007	2	3	2	40	14	0	14	26	100	65
12/2007	2	3	2	40	30	0	30	10	100	25
12/2007	2	3	2	40	19	1	20	20	95	50
12/2007	2	3	2	40	17	1	18	22	94.4	55
12/2007	2	3	2	40	25	0	25	15	100	37.5
1/2006	2	3.1	2	40	21	1	22	18	95.4	45

Date	Treatment	Velocity (ft/s)	Velocity condition	Number Released	Holding Tank Recovery	Sieve Net Recovery	Total Recovered	Total Missing	Holding Tank Recovery (percent)	Total Missing (percent)
1/2006	2	3.1	2	40	22	0	22	18	100	45
10/2007	3	2.51	2	40	27	3	30	10	90	25
10/2007	3	2.51	2	40	25	2	27	13	92.6	32.5
10/2007	3	2.51	2	40	24	0	24	16	100	40
10/2007	3	2.51	2	40	14	2	16	24	87.5	60
10/2007	3	2.51	2	40	12	1	13	27	92.3	67.5
10/2007	3	2.51	2	40	7	1	8	32	87.5	80
10/2007	3	2.51	2	40	12	0	12	28	100	70
10/2007	3	2.51	2	40	5	0	5	35	100	87.5
10/2007	3	2.51	2	40	17	5	22	18	77.3	45
10/2007	3	2.51	2	40	17	2	19	21	89.4	52.5
10/2007	3	2.51	2	40	24	5	29	11	82.8	27.5
10/2007	3	2.51	2	40	22	1	23	17	95.7	42.5
12/2007	3	2.9	2	40	20	0	20	20	100	50
12/2007	3	2.9	2	40	19	0	19	21	100	52.5
12/2007	3	2.9	2	40	22	0	22	18	100	45
12/2007	3	2.9	2	40	16	1	17	23	94.1	57.5
12/2007	3	2.9	2	40	25	1	26	14	96.1	35
12/2007	3	2.9	2	40	18	0	18	22	100	55
1/2006	3	2.9	2	40	23	1	24	16	95.8	40
1/2006	3	2.9	2	40	25	0	25	15	100	37.5
2/2009	1	3	2	40	37	0	37	3	100	7.5
2/2009	1	3	2	40	36	0	36	4	100	10

Date	Treatment	Velocity (ft/s)	Velocity condition	Number Released	Holding Tank Recovery	Sieve Net Recovery	Total Recovered	Total Missing	Holding Tank Recovery (percent)	Total Missing (percent)
2/2009	1	3	2	40	33	0	33	7	100	17.5
2/2009	2	2.9	2	40	33	0	33	7	100	17.5
2/2009	2	2.9	2	40	37	0	37	3	100	7.5
2/2009	2	2.9	2	40	38	1	39	1	97.4	2.5
2/2009	3	3	2	38	33	0	33	5	100	13.2
2/2009	3	3	2	39	38	0	38	2	100	5.1
2/2009	3	3	2	40	32	0	32	8	100	20